

REEL QUALITY ADX AUXILIARY MOUNT FOR DX SERIES REELS SAFETY INFORMATION AND INSTALLATION INSTRUCTIONS

Thank You for choosing Reel Quality Products, Inc.
Please read the following important safety and installation instructions before mounting and using the ADX Auxiliary Mount with your DX series cable lead reels.

Important Safety Information

Be certain you have a thorough knowledge of welding and welding procedures before attempting to use your new reels or reel accessories. Only properly trained persons should install and operate your reels. Improper installation or use can result in equipment damage, serious injury to yourself and others, or even death. Always ensure compliance with your local codes and laws when performing your installation and using your reel.

Auxiliary Mount Installation Instructions

Tools required: 5/16" hex key (Allen) wrench, measuring tape or ruler

1. Using a 5/16" hex key wrench, remove the top (2) 3/8-16 x 2 spindle cinching socket head cap screws located near the top of the vertical spindle mounting bars.
2. Using the (2) supplied 3/8-16 x 2-3/4 socket head cap screws, fasten the upright attachment bar to the now empty spindle cinching holes. Tighten to approximately 65 ft lb torque.
3. The long cross bar may be mounted in either of two locations: end mount or center mount. Center mount position is recommended for heavier equipment mounting
4. After determining your cross bar mount position, securely fasten to the upright attachment bar using the (2) 3/8-16 x 2 socket head cap screws.
5. Measure the base mount hole pattern of the equipment you are mounting and using the (4) self-locking 3/8-16 socket head cap screws, mount the (2) top bars in a suitable location to match the measured hole pattern.
6. Using 3/8-16 fasteners of a suitable length (not supplied) with thread locking compound (Loctite) and/or lock washers, mount your auxiliary equipment.